

OPERATING MANUAL

Gilson Silent Sifter® SS-21 & SS-21F and Gilson Silent Sifter® II SS-22 & SS-22F



SAFETY INSTRUCTIONS

Whether you are the owner, employer, operator, or maintenance person for this machine, safety is your responsibility. You are responsible for operating and maintaining this equipment in compliance with these instructions and for using common sense. Review and completely understand the operating and safety instructions before using this machine.

WARNING!

This machine operates on electric current. Improper operation could result in electric shock, electrocution, or an explosion!

- 1. **ALWAYS** ensure the motor and other electrical components are properly configured for your intended use and available power source. The Gilson SS-20 Rotary Sifter comes with a 1/3hp motor wired for 115V/60Hz. Motors are **NOT** explosion-proof.
- 2. **ALWAYS** check electrical wiring for loose connections and for pinched or frayed wiring.
- 3. **ALWAYS** use the factory-installed three-pronged plug. Connect the machine to a properly wired and grounded three-pronged receptacle. Make sure the cord is located where no one will trip or get tangled in it.
- 4. **ALWAYS** disconnect and lock out power supply before performing maintenance and repairs.

WARNING!

WARNING: DO NOT operate the machine without having all covers and cabinet in place.

- WARNING: Stop the machine immediately if excessive noise, vibration or machine movement occurs.
- *WARNING:* The electric motor on this machine has internal thermal protection. If the motor shuts off from overload, the machine may restart by itself after cooling off, unless the machine is unplugged during cool-down.
- WARNING: ALWAYS unplug or disconnect machine from the power source when the unit is not in operation.
- WARNING: Keep all parts of your body away from moving parts of the machine while it is operating.
- **WARNING:** ALWAYS wear safety glasses and recommended hearing protection when operating, maintaining, or repairing this machine.

Table of Contents

Page

	Safety	/ Instructions	2
	Table	of Contents	3
1.0	Introd	uction	4
2.0	Unpac	cking & Set-Up	4
3.0	3.1 3.2	ting Instructions & Components Test Specimen & Sieve Stack Assembly Timer Set-Up & Operation Components	4 4 5 6
4.0	Mainte	enance	7
5.0	Troub	leshooting	7
6.0	Speci	fications	7
7.0	7.1 7.2	Diagrams & Electrical Schematic External Parts Diagram Internal Parts Diagram Electrical Schematic	8 8 9 10
8.0	Parts 8.1	List Parts List	11 11
9.0	9.1 9.2 9.3 9.4	ional InformationGilson Test SievesTest Sieve & Screen Tray Verification & Services8in Diameter ASTM Test Sieves12in Diameter ASTM Test SievesISO 200/300mm Test SievesAccessories	12 12 13 15 16 17 18

1.0 INTRODUCTION:

GILSON SILENT SIFTER®

- Built by Gilson, backed by Gilson.
- Accurate results.
- · Simple and efficient.
- Ergonomic test positioning knob.

Gilson has revamped the classic rotary sifter design and added our own innovations. This proven sieving method preferred by many DOT's is now available with Gilsonguaranteed quality and reliability.

Gilson's progressive design carries forward the best features of traditional rotary sifters and adds upgrades drawn from our expertise in particle separation technology. Faster conversion between sieve sizes, easier set up, and quieter operation all reflect the time devoted to improved design and materials.

The totally enclosed design allows safe, dust-free operation. The cabinet is oriented at an angle, and the sieve stack is simply placed inside, resting against the rollers; no clamping is required. An ergonomic knob allows easy rotation of the cabinet between the loading and testing positions. A drive roller system continuously rotates the sieve stack with particle separation assisted by tapping against the stack. The digital countdown timer with large LED display precisely times operation.

2.0 UNPACKING & SET-UP:

The Gilson Rotary Sifter weighs approximately 215lbs. Use appropriate equipment and manpower to uncrate and assemble the Sifter. Wear safety glasses and work gloves.

The Gilson Sifters are shipped with the Steel Support Stand detached. The Sifter Cabinet must be installed on the Support Stand to operate properly. **DO NOT** attempt to operate the Sifter until properly assembled. See Figure 1 for components.

- 1. Remove the two halves of the Steel Support Stand from the box. Each half has a Frame Cross Rail partially bolted to the bottom rail.
- Set the Support Stand halves parallel to each other on a sturdy surface. Swing each cross rail out 90° and connect to the opposite bottom rail, securing with the bolts and nuts supplied. Tighten all connections securely.
- 3. Remove the top half of the pivot post mounts from the Floor Stand and set aside.

- 4. Use two people to lift the Sifter Cabinet and carefully set it vertically on the frame so that both Pivot Posts rest in the "saddle" of the pivot post mounts. Replace the top half of the mounts and secure the bolts.
- Check that all connections are secure and that the Sifter rotates properly 45° back from vertical to its testing position against the Cabinet Rotation Stops.
- 6. Carefully read and understand the rest of these instructions prior to operating the SS-21.
- 7. For any questions or issues, please contact Gilson Technical Support at **800.444.1508**, or email **techsupport@gilsonco.com**.

NOTE: Gilson Sifters come with a 1/4hp motor wired for 115V/60Hz, and the SS-21F and SS-22F motors are wired for 230V/50Hz. Either must be connected to a properly grounded, dedicated outlet of minimum 15 amp capacity. The motor is **NOT** explosion-proof.

3.0 OPERATING INSTRUCTIONS:

NOTE: Please read and understand all safety and operating instructions for the Gilson Silent Sifter[®] before putting it into service.

3.1 Test Specimen & Sieve Stack Assembly

The Gilson Silent Sifter[®] efficiently separates most freeflowing materials with particle sizes from No.4—No.200 (4.75mm—75µm). Performance on extended size ranges can be determined by experimentation. The test specimen should be large enough to be representative, without overloading any individual sieve. Maximum loading for individual sieves No.4 and finer should be no more than 200g for 8in sieves and 450g for 12in sieves, for materials with specific gravities similar to mineral aggregates. Sieves coarser than No.4 should be limited to about one particle of material for each available opening.

NOTE: Overloading on one or more sieves may result in incomplete separation, inaccurate results, or damage to the sieve cloth. Large samples should be tested as two or more batches, combining the results for final calculations.

Determine what size test sieves will be used, and adjust the Silent Sifter to the proper settings. There are two openings approximately 2in apart in the center of the cabinet bottom (see Figure 1). Insert the post of the sieve turntable into the proper opening; the opening toward the front is for 12in or 300mm diameter sieves, and the one toward the back is for 8in or 200mm diameter sieves. Set the sieve size selector knob on the front control panel to "12" or "8". This adjusts the springs controlling the tapping hammers for the best tapping force.

In addition to the test sieves selected for the test, the sieve stack must include the appropriate receiving pan and a sieve cover. Assemble the sieve stack with the pan and finest sieves on the bottom, progressing to the coarsest sieves on top. Deposit the prepared test specimen onto the top sieve, and put the cover on.

Open the cabinet door all the way. Special heavy-duty hinges allow the door to swing 170° for complete and easy access to the interior. Carefully place the entire sieve stack with sample on the sieve turntable in the Silent Sifter, resting the stack against the rubber-covered rollers in the back of the cabinet. Use the ergonomic knob on the side of the case to tilt the cabinet back against the cabinet rotation stops to its operating angle of approximately 45°. Taller operators may find it more convenient to load the sieve stack with the cabinet already tilted back. Close the cabinet door completely.

NOTE: Before starting a test cycle, the cabinet must be tilted back against the rotation stops. Failure to do this may result in incomplete separation or loss of the test specimen.

NOTE: The Door Safety Switch prevents operation of the Sifter and Timer until the cabinet door is completely closed. Disabling this switch makes operation of the Sifter dangerous and voids the warranty.

3.2 Timer Set-Up & Operation

This unit is equipped with an easy-to-operate Gilson interval count-down timer. The timer has a large 0.6in LED display and will operate in four different modes. It is powered by line voltage and will work on power supplies from 100–265 VAC, 50/60Hz, with up to 20 amps Inductive or Resistive current.

NOTE: The motor controlled by the timer is restricted to operating on a limited electrical supply range. Check carefully to insure compatibility with your electrical supply.

Current timer mode is indicated by the four red LED's on the timer face:

- A = MMSS (99min:59sec x 1 second)
- B = HHMM (99hr:59min x 1 minute)
- C = SSSS (9999sec x 1 second)
- D = MMMM (9999min x 1 minute)

(H is for hours, M for minutes, and S for seconds.) To adjust the timer mode, press and hold both <UP> and <DOWN> keys at the same time until the display shows the mode. Once the mode letters are displayed, press <UP> or <DOWN> to change modes. Press <START/ STOP> to accept new mode.

The time required to complete a test will vary depending upon the physical characteristics of the test material. Most separations will be complete in ten minutes or less. It may require experimentation to determine the optimum test time for a particular material.


To set the run time, press either <UP> or <DOWN>. The first digit on the right hand side will flash in half-second intervals. Press either arrow key to adjust to the desired value. To enter the displayed digit and move to the next, press <START/STOP>. Once the last digit on the left is entered, the timer is ready to start.

Insure the cabinet is rotated back to its operating angle of 45°, then Press <START/STOP> to initiate the current run program. Once running, pressing <START/STOP> again will pause the timer with the current amount of time remaining on screen. When allowed to time-out, the timer beeps and displays DONE. Press any key to reset the timer and prepare it for the next cycle. Setting and Mode values are saved automatically.

NOTE: Opening the cabinet door in the middle of a test cycle shuts off all power to the timer and motor. When the door is closed again, the timer will be reset to the originally programmed time interval.

When the test cycle is complete, open the cabinet door and remove the sieve stack for weight determinations.

3.3 Components

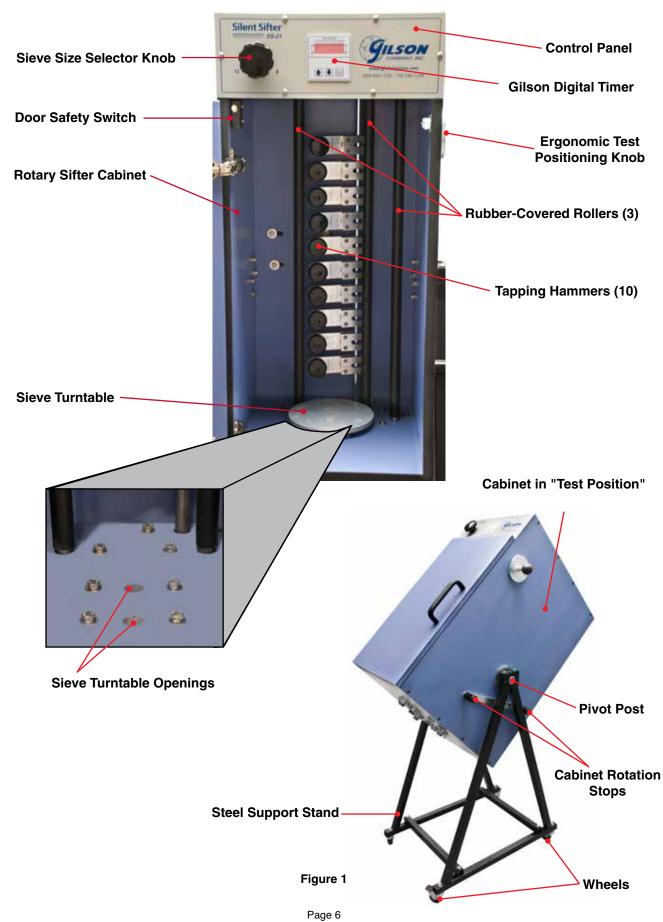

4.0 MAINTENANCE:

Before performing maintenance or repairs on the sieve shaker, **ALWAYS** read and understand the safety, operating, and maintenance instructions.

5.0 TROUBLESHOOTING:

	GILSON SILENT SIFTER & SILENT SIF	TER [®] II TROUBLESHOOTING
Symptoms	Possible Causes	Solutions
	Power disconnected.	Reconnect to power supply.
No power to display, machine will not operate.	Door not closed completely.	Close door completely.
	Faulty door safety switch.	Check connections and/or replace door safety switch.
	Faulty connections/wiring.	Trace circuits with electrical meter.
Display is lit, but motor does not run.	Faulty timer.	Diagnose timer output/connections.
	Faulty motor.	Replace motor.
	Loose or broken drive belt.	Adjust tension or replace belt.
Display is lit, motor runs, but	Pulley(s) loose on shaft(s).	Tighten set screws on shaft bearings.
machine does not operate properly.	Turntable installed in wrong opening.	Install turntable in correct opening.
	Sieve size selection knob not set correctly.	Set selection knob to correct size.
	Sieve stack not seated properly.	Seat sieve stack properly.
Excessive noise and vibration.	Turntable installed in wrong opening.	Install turntable in correct opening.
	Improperly adjusted or broken drive components.	Check belts, pulleys, bearings and rods. Adjust or replace as required.
	Sieve size selection knob not set correctly.	Set selection knob to correct size.
Excessive loss of specimen	Damaged or deformed sieve frames or flanges.	Replace damaged or deformed sieves.
fines during testing.	Sieves not seated properly.	Seat sieves properly.
	Damaged/out of specification sieve cloth.	Replace sieve.
Inconsistent or unexpected	Blinded sieve mesh.	Clean sieve.
test results.	Improper tapper operation.	Adjust or repair tappers.
x	Insufficient test time.	Increase test time.


Contact Gilson Technical Support for assistance in diagnosis and repair of problems with the Gilson Silent Sifter. E-mail: techsupport@gilsonco.com or Call: 800.444.1508

6.0 SPECIFICATIONS:

Particle Size Range:	No.4—No.200 (4.75mm—75µm) Nominal (Extended ranges possible, depending on material type.
Sieve Capacity:	8in or 200mm Diameter
	10 Full-Height
	20 Half-Height
	12in or 300mm
	6 Full-Height
	10 Intermediate-Height
	13 Half-Height
Controller:	Gilson Count-Down Timer, 99min:59sec x 1sec. (Maximum 99hr:59min x 1min).
Motor:	1/4hp, 1725rpm, Continuous Duty
Power Requirements:	115V/60Hz AC
Dimensions:	19x24x58in (483x610x1473mm), WxDxH
Weight:	195lb (88kg)
Ship Weight:	215lb (98kg)


7.0 PARTS DIAGRAMS & ELECTRICAL SCHEMATIC:

7.1 External Parts Diagram

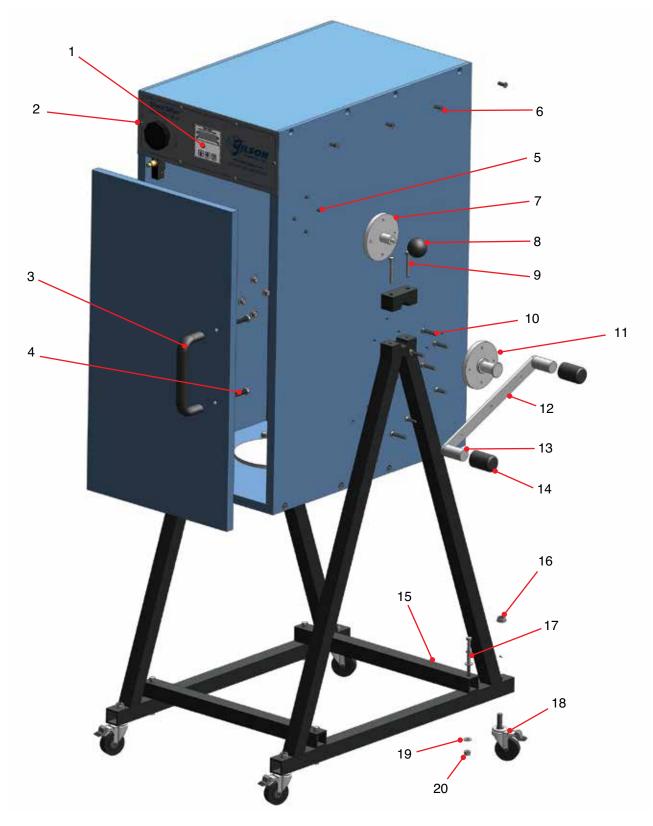


External Parts Diagram

7.2 Internal Parts Diagram

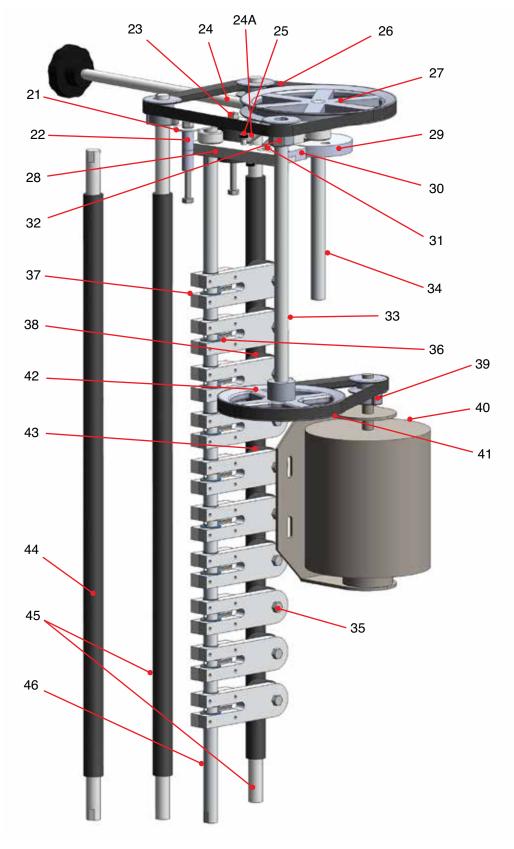



Internal Parts Diagram

7.2 Electrical Schematic

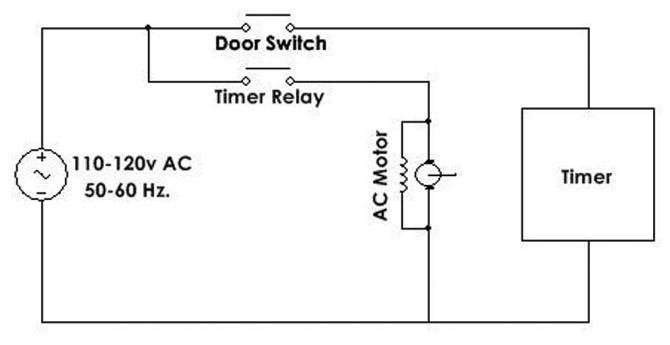

Electrical Schematic

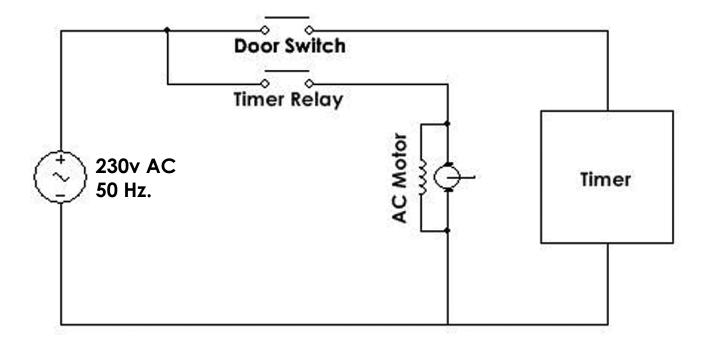



8.0 PARTS LIST:

8.1 Parts List

Item No.	Part No.	No. Req'd	Description
1	SSA-76	1	Timer/Controller
2	WGSW-832050TPMSS	6	Machine Screw (#8-32 x 0.5in Lg.)
3	WGRA-HANDLE	1	Door Handle
4	WGSW-516125PMSS	2	Machine Screw (5/16-18 x 1.25in Lg.)
5	WGSW-252100FAMSB	16	Machine Screw (1/4-20 x 1.00" Lg)
6	WGSW-252075FAMSB	16	Machine Screw (1/4-20 x 0.75in Lg.)
7	WGRA-PULLHANDLE	1	Mount For Pull Handle
8	WGRA-PULLKNOB	1	Pull Handle Knob
9	WGSW-252200HHMSS	4	Bolt (1/4-20 x 2in Lg.)
10	WGSW-252125HHMSS	8	Bolt (1/4-20 x 1.25" Lg.)
11	WGRA-ROTATEPOST	2	Pivot Post
12	WGRA-GUIDEBRKT	1	Tilt Guide
13	WGRA-STOPPER	2	Tilt Stop
14	WGRA-STPRCAPS	2	Tilt Stop Cap
15	WGRA-CROSSRAIL	2	Frame Cross Rail
16	WGNT-386HXSESZ	4	3/8-16 Self Locking Nut
17	WGSW-252300HHMSS	4	Bolt (1/4-20 x 3in Lg.)
18	WGRA-CASTERS	4	Locking Caster
19	WGWA-250FLNOSS	8	Washer (1/4 in)
20	WGRA-252HXNYSS	4	Lock Nut (1/4-20)
21	WGRA-CHS_Bracket	1	Silencer Bracket
22	WGSW-252075RUNY050	4	Nylon Standoff
23	WGNT-252HXNYSS	4	Lock Nut (1/4-20)
24	WGRA-SPRINGROD	1	Tensioner Rod
24A	WGRA-SPRING	2	Tension Spring
25	WGSW-SB-0204025038CAMSS	2	Machine Screw (#8-32 x 4/2 Lg.)
26	WGRA-VBELTUPPER	1	Upper V-Belt
27	WGRA-700X625PULLEY	1	Cam Pulley
28	WGRA-CAMARM	1	Cam Hammer Arm
29	WGRA-CAM	1	Cam
30	WGRA-CAMHAMMERHEAD	1	Cam Hammer Head
31	WGRA-024038TPMSS	2	Machine Screw (#10-24 x 0.375in Lg.)
32	WGRA-200X625PULLEY	3	Rod Pulley
33	WGRA-ROD13	1	Drive Shaft Rod
33	WGRA-ROD9	1	Cam Rod
35	WGRA-ROD9 WGSW-252100HHMSS	10	Bolt (1/4-20 x 1in Lg.)
36	WGRA-NYLINER	20	Nylon Spacer
30		10	Hammer Assembly
	SSA-72		
38	SSA-74	10	Hammer Head
39	WGRA-175X500 PULLEY	1	Motor Pulley
40 40	WGRA-MOTOR	1	Motor, 115V/60Hz
40F		1	Motor, 230V/50Hz
41	WGRA-VBELTLOWER	1	Lower V-Belt
42	WGRA-600X625PULLEY	1	Drive Pulley
43	SSA-12	10	Cover for Tapper
44	WGRA-IDLERASSY	1	Idle Rod
45	WGRA-DRIVERASSY	2	Driver Rod
46	WGRA-HAMMERROD	1	Hammer Rod

9.0 ADDITIONAL INFORMATION:

9.1 Gilson Test Sieves

Gilson stocks the widest range and largest quantity of sieves of any major supplier. Immediate shipment is available for all popular sizes. Custom sieves with special diameters and stacking heights are also available.

ASTM Sieves meet the requirements of ASTM E 11. ISO Sieves meet ISO 565 specifications with tolerances to ISO 3310-1. All are serial numbered and supplied with a certificate of manufacturing conformance.

ASTM and ISO Test Sieves are categorized in three different classes.

- **Compliance Test Sieves** are supplied with a basic certificate of manufacturing conformance. All Gilson Test Sieves meet Compliance grade requirements.
- Inspection Test Sieves have a specified number of openings measured and reported for each sieve.
- Calibration Test Sieves have two to three times as many openings measured on each sieve, and are supplied with more detailed documentation.

Mesh Opening

Opening Sizes are listed using standard millimeter (mm) or micrometer (μ m) descriptions, as well as traditional inch and number designations where appropriate. Gilson offers all mesh sizes, but not all sizes are available in every frame diameter. Common coarse sizes are also

listed. Normally, every second or fourth size is used, although precision testing may require consecutive sizes. Additional sieves are often inserted into the sequence to avoid overloading of individual sieves or to better define a particular size range.

ISO Sieve Cloth can be mounted in 8in (203mm) frames when special-ordered. These items are nonreturnable when supplied as ordered.

Frame Diameter

Frames should accommodate the entire sample volume with enough surface area to avoid overloading individual sieves. The diameter selected must also fit the sieve shaker being used. Gilson stocks most common sizes. Inquire for custom sizes.

Frame Height

Sieve frames are designated as Full-Height or Half-Height. Intermediate-Height sieves are also available for 3in and 12in diameters. Half or Intermediate-Height frames allow a greater number of sieves to be used when stack height is limited. Full-Height frames allow free movement of larger particles during agitation for more efficient separation. ISO Test Sieves are fitted with black rubber O-Rings.

Frame and Cloth Material

• Stainless Steel Frame with Stainless Steel Cloth assures a sieve with the longest possible service life. This is the best choice where contamination, sanitation or extreme wear is an issue.

	SIEVE FRAM	ME HEIGHTS &	PARTICLE TOP	SIZE LIMITS	
Sie	eve	Frame	Height	Particle	Topsize
Diameter	Frame Designation	Stacked	Overall	Recommended	Limit
3in (75mm)	FH IH HH	1-1/8 1 5/8	1-3/4 1-1/2 1-1/4	No.8 No.8 No.8	3/8in 3/8in 1/4in
6in (152mm)	FH HH	1-7/8 1-1/8	2-5/8 1-7/8	No.4 No.4	1/2in 3/8in
8in (203mm)	FH HH	2-1/8 1-1/8	2-5/8 1-5/8	No.4 No.4	1/2in 3/8in
200mm	FH HH	2-1/8 1-1/8	2-5/8 1-5/8	No.4 No.4	1/2in 3/8in
10in (254mm)	FH	3-1/8	4	3/8in	3/4in
12in (305mm)	E I I I I I I I I I I I I I I I I I I I	3-3/8 2-1/8 1-3/4	4-1/4 3 2-5/8	1/2in 1/2in 1/2in	1in 3/4in 1/2in
300mm	FH HH	2-1/2 1-1/2	3 2	1/2in 1/2in	3/4in 1/2in
18in (457mm)	FH	4-1/4	5-1/2	1-1/2in	2in

- Brass Frame with Stainless Steel Cloth is a popular choice that offers extended service and cost-effectiveness.
- Brass Frame with Brass Cloth is economical for lightduty applications. Coarse-series sieves are not available with brass cloth.

Backing Cloth

Back-up cloth prevents sagging or tearing of expensive fine stainless steel mesh. Unsatisfactory service life from a sieve would suggest replacement by a sieve built with backing cloth. To order, add the code "BU" to the model number of the sieve. These sieves are made-to-order, have longer delivery times and are non-returnable.

Pans and Covers

- Pans collect fines at the bottom of the sieve stack. Extended-Rim pans are also available to insert into the middle of a stack, allowing two samples to be tested at once.
- Covers are not necessary with most Gilson sieve shakers, but may be needed if using a different shaker or shaking by hand. The Cover-with-Ring has a wire finger loop in the center to facilitate removal.

Gilson Sieve Verification Services

Gilson Verification can be performed on any test sieve or Gilson screen tray, used or new. These services are ordered by specifying the appropriate model number given in our listing for Test Sieve and Screen Tray Verification and Services. An optical comparator with NIST traceable calibration measures opening sizes and wire diameters on each sieve, and a statistical analysis assures the standard deviations are within ASTM or ISO requirements for Inspection or Calibration grades. Sieves, trays, or wire cloth units are not included in the purchase price of the verification services. Because wire cloth stretches, sags, or tears, and abrasive materials can reduce wire diameters, a verification process should also be set up to regularly verify that working sieves still meet the specifications. These measurements can be taken directly using calipers or an optical comparator, by testing with Standard Reference Materials, or by returning to Gilson for Re-Verification. To verify used sieves, contact a Gilson customer service representative for shipping instructions.

Standard Reference Materials (SRM's)

Sieve Reference Materials are precision glass beads or powders for performance testing of sieves. They are traceable to the National Institute of Standards and Technology (NIST), or European Community Bureau of Reference (BCR). SRM's fit easily into internal quality programs following guidelines in ASTM E 2427, *Sieve Acceptance by Performance Testing.* User-Prepared Reference Materials can also be utilized under E 2427 in the same manner as SRM's. Because user materials are non-standard, they are not traceable and require much more handling. In addition, the user must determine acceptable tolerances for statistical analysis.

Sieve Shakers

The proper sieve shaker saves considerable time and effort, and yields superior accuracy, consistency, and repeatability compared to manual shaking methods for particle sizing. Effective agitation lifts all particles off the sieve cloth, reorients them, and allows them to be repeatedly "tried" to different openings at different angles. Careful review of shaker specifications allows optimal choices for different materials and applications. Greater sample volumes and large particle topsize may indicate selection of Gilson Test-Master[®], Testing Screen or Porta-Screen[®] models for efficient processing.

9.2 Test Sieve & Screen Tray Verification & Services

There have been extensive revisions to the newest version of ASTM standard E 11, *Specification for Wire Cloth and Sieves for Testing Purposes.* Gilson is leading the way in educating our customers about the new specification and making these new products available. The new specification affects all test sieves, screen trays, and wire cloth, and changes the way the mesh openings are evaluated by looking at the statistical distribution of aperture sizes, rather than just the average opening sizes. In addition to a more accurate and reliable system of evaluation, the new system also allows compatibility with ISO 565 and 3310-1 requirements. There are now three grades, or classes of ASTM or ISO test sieves available; Compliance, Inspection and Calibration.

- **Compliance Test Sieves** are manufactured with wire cloth that has been inspected and measured in roll or sheet quantities prior to being cut and mounted in the individual sieve frames. Opening sizes are not measured in individual sieves. Each Compliance sieve is supplied with a certificate of manufacturing compliance, but no statistical documentation is given. Compliance sieves are designed for applications where a basic, reliable degree of accuracy and repeatability are sufficient.
- Inspection Test Sieves have a specified number of openings measured in each sieve after the cloth is mounted in the frame. There is a 99% confidence level that the standard deviation of these openings is within the maximum allowed by ASTM. Inspection Sieves are a good choice in applications where accuracy and repeatability are critical. Each Inspection Sieve consists of a Compliance Sieve with added Inspection Sieve Verification service.

 Calibration Test Sieves have about twice as many openings measured as Inspection Sieves. The higher number of openings measured on each sieve increases the confidence level to 99.73% that the standard deviation of these openings is within the maximum allowed by ASTM. Calibration Sieves should be used in applications where a very high degree of accuracy is required. Each Calibration Sieve consists of a compliance sieve with added Calibration Sieve Verification service.

New Gilson Test Sieves are guaranteed to meet the requirements of ASTM or ISO for Compliance, Inspection or Calibration grades as ordered, but for continued assurance of performance, procedures should be in place to regularly check working sieves as they age. Wire cloth stretches, sags, or even tears, and abrasive materials reduce wire diameter, causing an increase in opening size and loss of accuracy over time.

These same verification services are also available for screen trays used in Gilson Testing Screens, Test-Master[®], Porta-Screen[®] and Gilso-Matic[®] machines.

Gilson Reverification Services can be performed on used ASTM or ISO Test Sieves or Screen Trays. An optical comparator with NIST traceable calibration measures opening and wire diameter sizes on each sieve. Certification reports are produced for the appropriate grade. These services are available for all ASTM and ISO sieve sizes and types, and are ordered by specifying model numbers for Inspection Sieve Verification, or Calibration Sieve Verification. Sieves are not included in the purchase price. When verifying used sieves, contact a Gilson customer service representative for shipping instructions.

Master-Matched Sieves are ASTM 8in diameter stainless woven-wire sieves from No.8 (2.36mm) to No.325 (45μ m) that have been measured and shown to closely match a set of master sieves maintained by Gilson in a reference laboratory. Master-Matched Sieves from Gilson are always matched to the same master set, assuring that one sieve is very close to another. Master-Matched Sieves are also certified to meet ASTM E 11, so additional verification is not normally necessary. Master-Matching is done using special standard reference materials, sized for each sieve. Each sieve is performance tested to insure it yields $\pm 2\%$ by weight of the value of the master sieve.

Ordering

All Gilson test sieves meet ASTM or ISO requirements for Compliance Test Sieves. Ordering additional verification services for each individual sieve upgrades them to meet Inspection or Calibration specifications.







Certificate of E 11 Compliance for all Sieves

TEST SIEVE & SCREEN TRAY VERIFICATION & S	SERVICES
Description	Model
Inspection Test Sieve Verification, ASTM E 11	GV-60
Calibration Test Sieve Verification, ASTM E 11	GV-65
Inspection Test Sieve Verification, ISO 565 and 3310-1	GV-62
Calibration Test Sieve Verification, ISO 565 and 3310-1	GV-63
Inspection Screen Tray Verification, ASTM E 11	GV-61
Calibration Screen Tray Verification, ASTM E 11	GV-66
Inspection Screen Tray Verification, ISO 565 and 3310-1	GV-64
Calibration Screen Tray Verification, ISO 565 and 3310-1	GV-67
Master-Matched Sieves	MM-70

9.3 8in Diameter ASTM Test Sieves

			8IN DIA	METER AS	TM TEST S	IEVES		
	AS	тм		Cloth Frame		ss Cloth Frame	Stainles Stainles	
			Full Ht.	Half Ht.	Full Ht.	Half Ht.	Full Ht.	Half Ht.
	4in	100.0mm	_	_	V8CF 4"	V8CH 4"	V8SF 4"	-
	3-1/2in	90.0mm	—	—	V8CF 3-1/2"	V8CH 3-1/2"	V8SF 3-1/2"	—
	3in	75.0mm	—	—	V8CF 3"	V8CH 3"	V8SF 3"	—
	2-1/2in 2.12in	63.0mm 53.0mm	_	_	V8CF 2-1/2" V8CF 2.12"	V8CH 2-1/2" V8CH 2.12"	V8SF 2-1/2" V8SF 2.12"	_
C	2.1211 2in	50.0mm	_		V8CF 2"	V8CH 2"	V8SF 2"	
0	1-3/4in	45.0mm	_	_	V8CF 1-3/4"	V8CH 1-3/4"	V8SF 1-3/4"	_
A R	1-1/2in	37.5mm	_	_	V8CF 1-1/2"	V8CH 1-1/2"	V8SF 1-1/2"	_
S	1-1/4in	31.5mm	-	—	V8CF 1-1/4"	V8CH 1-1/4"	V8SF 1-1/4"	-
Ĕ	1.06in	26.5mm	-	—	V8CF 1.06"	V8CH 1.06"	V8SF 1.06"	-
	1in	25.0mm	_	_	V8CF 1"	V8CH 1"	V8SF 1"	V8SH 1"
S	7/8in	22.4mm	_	_	V8CF 7/8"	V8CH 7/8"	V8SF 7/8"	V8SH 7/8"
Е	3/4in 5/8in	19.0mm 16.0mm	_	_	V8CF 3/4" V8CF 5/8"	V8CH 3/4" V8CH 5/8"	V8SF 3/4" V8SF 5/8"	V8SH 3/4" V8SH 5/8"
R	0.530in	13.2mm	_	_	V8CF .530"	V8CH .530"	V8SF .530"	V8SH .530"
L.	1/2in	12.5mm	_	_	V8CF 1/2"	V8CH 1/2"	V8SF 1/2"	V8SH 1/2"
E S	7/16in	11.2mm	—	_	V8CF 7/16"	V8CH 7/16"	V8SF 7/16"	V8SH 7/16"
3	3/8in	9.5mm	—	-	V8CF 3/8"	V8CH 3/8"	V8SF 3/8"	V8SH 3/8"
	5/16in	8.0mm	-	—	V8CF 5/16"	V8CH 5/16"	V8SF 5/16"	V8SH 5/16"
	0.265in	6.7mm	—	—	V8CF .265"	V8CH .265"	V8SF .265"	V8SH .265"
	1/4in No.3-1/2	6.3mm	— V8BF #3-1/2		V8CF 1/4"	V8CH 1/4"	V8SF 1/4"	V8SH 1/4"
	No.3-1/2 No.4	5.6mm 4.75mm	V8BF #3-1/2 V8BF #4	V8BH #3-1/2 V8BH #4	V8CF #3-1/2 V8CF #4	V8CH #3-1/2 V8CH #4	V8SF #3-1/2 V8SF #4	V8SH #3-1/2 V8SH #4
		4.7511111	-					
	No.5	4.0mm	V8BF #5	V8BH #5	V8CF #5	V8CH #5	V8SF #5	V8SH #5
	No.6	3.35mm	V8BF #6	V8BH #6	V8CF #6	V8CH #6	V8SF #6	V8SH #6
	1/8in ¹	3.18mm			V8CF 1/8"	V8CH 1/8"	V8SF 1/8"	V8SH 1/8"
	No.7 No.8	2.8mm 2.36mm	V8BF #7 V8BF #8	V8BH #7 V8BH #8	V8CF #7 V8CF #8	V8CH #7 V8CH #8	V8SF #7 V8SF #8	V8SH #7 V8SH #8
	No.10	2.00mm	V8BF #10	V8BH #10	V8CF #10	V8CH #10	V8SF #10	V8SH #10
	No.12	1.7mm	V8BF #12	V8BH #12	V8CF #12	V8CH #12	V8SF #12	V8SH #12
	No.14	1.4mm	V8BF #14	V8BH #14	V8CF #14	V8CH #14	V8SF #14	V8SH #14
	No.16	1.18mm	V8BF #16	V8BH #16	V8CF #16	V8CH #16	V8SF #16	V8SH #16
	No.18	1.0mm	V8BF #18	V8BH #18	V8CF #18	V8CH #18	V8SF #18	V8SH #18
F	No.20	850µm	V8BF #20	V8BH #20	V8CF #20	V8CH #20	V8SF #20	V8SH #20
	No.25 No.30	710µm 600µm	V8BF #25 V8BF #30	V8BH #25 V8BH #30	V8CF #25 V8CF #30	V8CH #25 V8CH #30	V8SF #25 V8SF #30	V8SH #25 V8SH #30
N	No.35	500µm	V8BF #35	V8BH #35	V8CF #35	V8CH #35	V8SF #35	V8SH #35
E	No.40	425µm	V8BF #40	V8BH #40	V8CF #40	V8CH #40	V8SF #40	V8SH #40
s	No.45	355µm	V8BF #45	V8BH #45	V8CF #45	V8CH #45	V8SF #45	V8SH #45
E	No.50	300µm	V8BF #50	V8BH #50	V8CF #50	V8CH #50	V8SF #50	V8SH #50
R	No.60	250µm	V8BF #60	V8BH #60	V8CF #60	V8CH #60	V8SF #60	V8SH #60
Ĩ	No.70	212µm	V8BF #70	V8BH #70	V8CF #70	V8CH #70	V8SF #70	V8SH #70
Е	No.80	180µm	V8BF #80	V8BH #80	V8CF #80	V8CH #80	V8SF #80	V8SH #80
S	No.100 No.120	150µm 125µm	V8BF #100	V8BH #100	V8CF #100 V8CF #120	V8CH #100	V8SF #100	V8SH #100
	No.120 No.140	106µm	V8BF #120 V8BF #140	V8BH #120 V8BH #140	V8CF #120 V8CF #140	V8CH #120 V8CH #140	V8SF #120 V8SF #140	V8SH #120 V8SH #140
	No.170	90µm	V8BF #170	V8BH #170	V8CF #170	V8CH #170	V8SF #170	V8SH #170
	No.200	75µm	V8BF #200	V8BH #200	V8CF #200	V8CH #200	V8SF #200	V8SH #200
	No.230	63µm	V8BF #230	V8BH #230	V8CF #230	V8CH #230	V8SF #230	V8SH #230
	No.270	53µm	V8BF #270	V8BH #270	V8CF #270	V8CH #270	V8SF #270	V8SH #270
	No.325	45µm	V8BF #325	V8BH #325	V8CF #325	V8CH #325	V8SF #325	V8SH #325
	No.400	38µm	V8BF #400	V8BH #400	V8CF #400	V8CH #400	V8SF #400	V8SH #400
	No.450 No.500	32µm 25µm	_	_	V8CF #450 V8CF #500	V8CH #450 V8CH #500	V8SF #450 V8SF #500	V8SH #450 V8SH #500
	No.635	25μm 20μm	_	_	V8CF #500 V8CF #635	V8CH #500 V8CH #635	V8SF #500 V8SF #635	V8SH #500 V8SH #635
	Regular Pa		V8BFXPN	V8BHXPN	V8BFXPN	V8BHXPN	V8SFXPN	V8SHXPN
	Extended I		V8BFXPE	V8BHXPE	V8BFXPE	V8BHXPE	V8SFXPE	V8SHXPR
	Regular Co			XCV		XCV	V8SF	
	Cover with	Ring	V8BF	XCR	V8BF	XCR	V8SF	XCR



8in Round Test Sieves



¹ Not a standard ASTM E 11 size.

SS-21

9.4 12in Diameter ASTM Test Sieves

				1	2IN DIAME	TER ASTM 1	TEST SIEVE	S			
	AS	тм		Brass Cloth Brass Frame			ainless Cloth Brass Frame	ו		Stainless Clo Stainless Fra	
			Full Ht.	Inter. Ht.	Half Ht.	Full Ht.	Inter. Ht.	Half Ht.	Full Ht.	Inter. Ht.	Half Ht.
	4in	100.0mm	_	_	_	V12CF 4"	V12CI 4"	V12CH 4"	V12SF 4"	V12SI 4"	V12SH 4"
	3-1/2in	90.0mm	-	-	-	V12CF 3-1/2"	V12CI 3-1/2"	V12CH 3-1/2"	V12SF 3-1/2"	V12SI 3-1/2"	V12SH 3-1/2"
	3in	75.0mm	-	—	-	V12CF 3"	V12CI 3"	V12CH 3"	V12SF 3"	V12SI 3"	V12SH 3"
	2-1/2in	63.0mm	-	-	-	V12CF 2-1/2"	V12CI 2-1/2"	V12CH 2-1/2"	V12SF 2-1/2"	V12SI 2-1/2"	V12SH 2-1/2"
С	2.12in 2in	53.0mm 50.0mm	_	-		V12CF 2.12" V12CF 2"	V12CI 2.12" V12CI 2"	V12CH 2.12" V12CH 2"	V12SF 2.12" V12SF 2"	V12SI 2.12" V12SI 2"	V12SH 2.12" V12SH 2"
0	1-3/4in	45.0mm	_	_	_	V12CF 2 V12CF 1-3/4"	V12CI 2 V12CI 1-3/4"	V12CH 2-3/4"	V12SF 2 V12SF 1-3/4"	V12SI 2 V12SI 1-3/4"	V12SH 1-3/4"
A	1-1/2in	37.5mm	_	_	_	V12CF 1-1/2"	V12CI 1-1/2"	V12CH 1-1/2"	V12SF 1-1/2"	V12SI 1-1/2"	V12SH 1-1/2"
R	1-1/4in	31.5mm	_	_	_	V12CF 1-1/4"	V12CI 1-1/4"	V12CH 1-1/4"	V12SF 1-1/4"	V12SI 1-1/4"	V12SH 1-1/4"
S E	1.06in	26.5mm	_	_	_	V12CF 1.06"	V12CI 1.06"	V12CH 1.06"	V12SF 1.06"	V12SI 1.06"	V12SH 1.06"
-	1in	25.0mm	-	—	-	V12CF 1"	V12CI 1"	V12CH 1"	V12SF 1"	V12SI 1"	V12SH 1"
S	7/8in	22.4mm	-	-	_	V12CF 7/8"	V12CI 7/8"	V12CH 7/8"	V12SF 7/8"	V12SI 7/8"	V12SH 7/8"
Ē	3/4in 5/8in	19.0mm 16.0mm	_	_	-	V12CF 3/4" V12CF 5/8"	V12CI 3/4" V12CI 5/8"	V12CH 3/4" V12CH 5/8"	V12SF 3/4" V12SF 5/8"	V12SI 3/4" V12SI 5/8"	V12SH 3/4" V12SH 5/8"
R	0.530in	13.2mm	_	_	_	V12CF 5/8 V12CF .530"	V12CI 5/8 V12CI .530"	V12CH 5/8 V12CH .530"	V12SF 5/8 V12SF .530"	V12SI 5/8 V12SI .530"	V12SH 5/8 V12SH .530"
<u> </u>	1/2in	12.5mm	_	_	_	V12CF 1/2"	V12CI 1/2"	V12CH 1/2"	V12SF 1/2"	V12SI 1/2"	V12SH 1/2"
E S	7/16in	11.2mm	_	_	_	V12CF 7/16"	V12CI 7/16"	V12CH 7/16"	V12SF 7/16"	V12SI 7/16"	V12SH 7/16"
5	3/8in	9.5mm	-	—	_	V12CF 3/8"	V12CI 3/8"	V12CH 3/8"	V12SF 3/8"	V12SI 3/8"	V12SH 3/8"
	5/16in	8.0mm	-	-	-	V12CF 5/16"	V12CI 5/16"	V12CH 5/16"	V12SF 5/16"	V12SI 5/16"	V12SH 5/16"
	0.265in	6.7mm	_	_	_	V12CF .265"	V12CI .265"	V12CH .265"	V12SF .265"	V12SI .265"	V12SH .265"
	1/4in	6.3mm	-	—	-	V12CF 1/4"	V12CI 1/4"	V12CH 1/4"	V12SF 1/4" V12SF #3-1/2	V12SI 1/4" V12SI #3-1/2	V12SH 1/4"
	No.3-1/2 No.4	5.6mm 4.75mm	_	_	_	V12CF #3-1/2 V12CF #4	V12CI #3-1/2 V12CI #4	V12CH #3-1/2 V12CH #4	V12SF #3-1/2 V12SF #4	V12SI#3-1/2 V12SI#4	V12SH #3-1/2 V12SH #4
	110.4										
	No.5	4.0mm	-	—	-	V12CF #5	V12CI #5	V12CH #5	V12SF #5	V12SI #5	V12SH #5
	No.6	3.35mm	-	—	-	V12CF #6	V12CI #6	V12CH #6	V12SF #6	V12SI #6	V12SH #6
	1/8in ¹ No.7	3.18mm 2.8mm	_	_	_	V12CF 1/8" V12CF #7	V12CI 1/8" V12CI #7	V12CH 1/8" V12CH #7	V12SF 1/8" V12SF #7	V12SI 1/8" V12SI #7	V12SH 1/8" V12SH #7
	No.8	2.36mm		V12BI #8		V12CF #8	V12CI #8	V12CH #8	V12SF #8	V12SI #8	V12SH #8
	No.10	2.0mm	V12BF #10	V12BI #10	V12BH #10	V12CF #10	V12CI #10	V12CH #10	V12SF #10	V12SI #10	V12SH #10
	No.12	1.7mm	V12BF #12	V12BI #12	V12BH #12	V12CF #12	V12CI #12	V12CH #12	V12SF #12	V12SI #12	V12SH #12
	No.14	1.4mm	V12BF #14	V12BI #14	V12BH #14	V12CF #14	V12CI #14	V12CH #14	V12SF #14	V12SI #14	V12SH #14
	No.16	1.18mm	V12BF #16	V12BI #16	V12BH #16	V12CF #16	V12CI #16	V12CH #16	V12SF #16	V12SI #16	V12SH #16
_	No.18	1.0mm	V12BF #18	V12BI #18	V12BH #18	V12CF #18	V12CI #18	V12CH #18	V12SF #18	V12SI #18	V12SH #18
F	No.20 No.25	850μm 710μm	V12BF #20 V12BF #25	V12BI #20 V12BI #25	V12BH #20 V12BH #25	V12CF #20 V12CF #25	V12CI #20 V12CI #25	V12CH #20 V12CH #25	V12SF #20 V12SF #25	V12SI #20 V12SI #25	V12SH #20 V12SH #25
Ň	No.30	600µm	V12BF #30	V12BI #20 V12BI #30	V12BH #30	V12CF #30	V12CI #30	V12CH #30	V12SF #25	V12SI #25	V12SH #30
Ë	No.35	500µm	V12BF #35	V12BI #35	V12BH #35	V12CF #35	V12CI #35	V12CH #35	V12SF #35	V12SI #35	V12SH #35
_	No.40	425µm	V12BF #40	V12BI #40	V12BH #40	V12CF #40	V12CI #40	V12CH #40	V12SF #40	V12SI #40	V12SH #40
S	No.45	355µm	V12BF #45	V12BI #45	V12BH #45	V12CF #45	V12CI #45	V12CH #45	V12SF #45	V12SI #45	V12SH #45
E	No.50	300µm	V12BF #50	V12BI #50	V12BH #50	V12CF #50	V12CI #50	V12CH #50	V12SF #50	V12SI #50	V12SH #50
R	No.60	250µm	V12BF #60	V12BI #60	V12BH #60	V12CF #60	V12CI #60	V12CH #60	V12SF #60	V12SI #60	V12SH #60
Ë	No.70 No.80	212µm 180µm	V12BF #70 V12BF #80	V12BI #70 V12BI #80	V12BH #70 V12BH #80	V12CF #70 V12CF #80	V12CI #70 V12CI #80	V12CH #70 V12CH #80	V12SF #70 V12SF #80	V12SI #70 V12SI #80	V12SH #70 V12SH #80
S	No.100	150µm	V12BF #100	V12BI #00 V12BI #100	V12BH #100	V12CF #100	V12CI #100	V12CH #100	V12SF #100	V12SI #100	V12SH #100
Ŭ	No.120	125µm	V12BF #120	V12BI #120	V12BH #120	V12CF #120	V12CI #120	V12CH #120	V12SF #120	V12SI #120	V12SH #120
	No.140	106µm	V12BF #140	V12BI #140	V12BH #140	V12CF #140	V12CI #140	V12CH #140	V12SF #140	V12SI #140	V12SH #140
	No.170	90µm	V12BF #170	V12BI #170	V12BH #170	V12CF #170	V12CI #170	V12CH #170	V12SF #170	V12SI #170	V12SH #170
	No.200	75µm	V12BF #200	V12BI #200	V12BH #200	V12CF #200	V12CI #200	V12CH #200	V12SF #200	V12SI #200	V12SH #200
	No.230	63µm	V12BF #230	V12BI #230	V12BH #230	V12CF #230	V12CI #230	V12CH #230	V12SF #230	V12SI #230	V12SH #230
	No.270 No.325	53µm 45µm	V12BF #270 V12BF #325	V12BI #270 V12BI #325	V12BH #270 V12BH #325	V12CF #270 V12CF #325	V12CI #270 V12CI #325	V12CH #270 V12CH #325	V12SF #270 V12SF #325	V12SI #270 V12SI #325	V12SH #270 V12SH #325
	No.400	45μm 38μm	- vizbr #325	V12BI #325 V12BI #400	V12BH #400	V12CF #325 V12CF #400	V12CI #325	V12CH #325	V12SF #325 V12SF #400	V12SI #325 V12SI #400	V12SH #400
	No.450	32µm	-		_	V12CF #450	V12CI #450	V12CH #450	V12SF #450	V12SI #450	V12SH #450
	No.500	25µm	-	-	_	V12CF #500	V12CI #500	V12CH #500	V12SF #500	V12SI #500	V12SH #500
	No.635	20µm	_	-	_	V12CF #635	V12CI #635	V12CH #635	V12SF #635	V12SI #635	V12SH #635
	Regular Pa		V12BFXPN	V12BIXPN	V12BHXPN	V12BFXPN	V12BIXPN	V12BHXPN	V12SFXPN	-	V12SHXPN
	Extended F		V12BFXPE	V12BIXPE	V12BHXPE	V12BFXPE	V12BIXPE	V12BHXPE	V12SFXPE	V12SIXPE	V12SHXPE
	Regular Co Cover with			V12BFXCV V12BFXCR			V12BFXCV V12BFXCR			V12SFXCV V12SFXCR	
		ard ASTM E 11	sizo							• 1201 AUT)

Not a standard ASTM E 11 size.

9.5 ISO 200/300mm Test Sieves

			ISO 200	/300MM TES	T SIEVES		
			200	mm		300n	nm
	ISO 565, 3310-1		ss Cloth Frame		ss Cloth ss Frame		ss Cloth s Frame
		Full Ht.	Half Ht.	Full Ht.	Half Ht.	Full Ht.	Half Ht.
COARSE SERIES	63.0mm 56.0mm 53.0mm 45.0mm 40.0mm 37.5mm 35.5mm 31.5mm 28.0mm 22.4mm 22.0mm 19.0mm 18.0mm 14.0mm 13.2mm 11.2mm 11.2mm 10.0mm 9.5mm 7.1mm 6.3mm 6.3mm 5.6mm 4.75mm	V200CF 63M V200CF 56M V200CF 53M V200CF 50M V200CF 45M V200CF 45M V200CF 35.5M V200CF 35.5M V200CF 28.5M V200CF 26.5M V200CF 22.4M V200CF 22.4M V200CF 22.4M V200CF 12.2M V200CF 18M V200CF 18M V200CF 18M V200CF 13.2M V200CF 13.2M V200CF 13.2M V200CF 13.2M V200CF 12.5M V200CF 9.5M V200CF 9.5M V200CF 6.7M V200CF 6.7M V200CF 5.6M V200CF 5.6M V200CF 4.5M	V200CH 63M V200CH 56M V200CH 53M V200CH 45M V200CH 45M V200CH 40M V200CH 37.5M V200CH 35.5M V200CH 35.5M V200CH 28M V200CH 28M V200CH 22M V200CH 22M V200CH 22M V200CH 22M V200CH 19M V200CH 18M V200CH 13.2M V200CH 13.2M V200CH 13.2M V200CH 13.2M V200CH 13.2M V200CH 9.5M V200CH 6.7M V200CH 6.7M V200CH 6.7M V200CH 6.7M V200CH 6.7M V200CH 6.5M V200CH 5.6M V200CH 5.6M V200CH 5.5M V200CH 4.5M	V200SF 63M V200SF 56M V200SF 55M V200SF 50M V200SF 40M V200SF 40M V200SF 37.5M V200SF 28.5M V200SF 28.5M V200SF 26.5M V200SF 26.5M V200SF 20M V200SF 20M V200SF 19M V200SF 19M V200SF 19M V200SF 18M V200SF 14M V200SF 11.2M V200SF 11.2M V200SF 10M V200SF 10M V200SF 9.5M V200SF 6.7M V200SF 6.7M V200SF 6.7M V200SF 5.6M V200SF 5.6M V200SF 5.4.5M	V200SH 63M V200SH 53M V200SH 53M V200SH 53M V200SH 45M V200SH 45M V200SH 37.5M V200SH 35.5M V200SH 28M V200SH 28M V200SH 22.4M V200SH 22.4M V200SH 22.4M V200SH 22.4M V200SH 20M V200SH 18M V200SH 18M V200SH 18M V200SH 13.2M V200SH 13.2M V200SH 13.2M V200SH 13.2M V200SH 14M V200SH 13.2M V200SH 12.5M V200SH 3.5M V200SH 9.5M V200SH 6.7M V200SH 5.6M V200SH 5.6M V200SH 4.5M	V300SF 63M V300SF 56M V300SF 53M V300SF 50M V300SF 45M V300SF 45M V300SF 37.5M V300SF 35.5M V300SF 28.5M V300SF 28.5M V300SF 22.4M V300SF 22.4M V300SF 22.4M V300SF 20M V300SF 18M V300SF 18M V300SF 18M V300SF 14M V300SF 14M V300SF 15.5M V300SF 9.5M V300SF 9.5M V300SF 6.7M V300SF 6.7M V300SF 5.6M V300SF 5.6M V300SF 5.5M V300SF 4.5M	V300SH 63M V300SH 56M V300SH 53M V300SH 50M V300SH 40M V300SH 45M V300SH 47.5M V300SH 35.5M V300SH 28.5M V300SH 28.5M V300SH 26.5M V300SH 26.5M V300SH 20M V300SH 20M V300SH 18M V300SH 18M V300SH 18M V300SH 13.2M V300SH 13.2M V300SH 13.2M V300SH 11.2M V300SH 11.2M V300SH 11.2M V300SH 11.2M V300SH 11.2M V300SH 10M V300SH 5.5M V300SH 6.7M V300SH 6.7M V300SH 5.6M V300SH 5.6M V300SH 5.5M V300SH 5.5M
F-NE SER-ES	4.00mm 3.55mm 3.35mm 3.35mm 2.80mm 2.36mm 2.24mm 2.24mm 1.80mm 1.60mm 1.40mm 1.25mm 1.12mm 1.12mm 1.12mm 1.12mm 1.00mm 900µm 850µm 850µm 800µm 600µm 560µm 450µm 450µm 315µm 300µm 224µm 224µm 200µm 150µm 160µm 150µm 150µm 150µm 160µm 150µm 160µm 150µm 160µm 150µm 160µm 150µm 160µm 150µm 160µm 150µm 160µm 160µm 150µm 160µm 100µm	V200CF 4M V200CF 3.55M V200CF 3.55M V200CF 3.35M V200CF 2.5M V200CF 2.5M V200CF 2.5M V200CF 2.5M V200CF 2.5M V200CF 2.25M V200CF 2.25M V200CF 1.7M V200CF 1.7M V200CF 1.7M V200CF 1.7M V200CF 1.7M V200CF 1.25M V200CF 1.25M V200CF 1.25M V200CF 1.25M V200CF 1.25M V200CF 4.00U V200CF 630U V200CF 630U V200CF 630U V200CF 630U V200CF 630U V200CF 630U V200CF 630U V200CF 630U V200CF 450U V200CF 450U V200CF 450U V200CF 315U V200CF 315U V200CF 250U V200CF 250U V200CF 250U V200CF 250U V200CF 250U V200CF 160U V200CF 150U V200CF 160U V200CF 15U V200CF 100U V200CF 100U V200CF 100U V200CF 100U V200CF 53U V200CF 53U V200CF 53U V200CF 53U V200CF 53U V200CF 53U V200CF 32U V200CF 32U V200CF 32U V200CF 32U V200CF 32U V200CF 220U V200CF 32U V200CF 220U V200CF 32U V200CF 32U V200CF 25U V200CF 32U V200CF 32U V200CF 32U V200CF 25U V200CF 32U V200CF 25U V200CF 25U V200CF 32U V200CF 32U V200CF 25U	V200CH 4M V200CH 3.55M V200CH 3.55M V200CH 3.55M V200CH 2.36M V200CH 2.36M V200CH 2.36M V200CH 2.36M V200CH 2.36M V200CH 2.36M V200CH 2.36M V200CH 1.6M V200CH 1.6M V200CH 1.6M V200CH 1.6M V200CH 1.6M V200CH 1.6M V200CH 1.6M V200CH 1.6M V200CH 1.25M V200CH 1.25M V200CH 1.12M V200CH 4.50U V200CH 800U V200CH 800U V200CH 800U V200CH 800U V200CH 630U V200CH 630U V200CH 400U V200CH 400U V200CH 450U V200CH 160U V200CH 100U V200CH 100U V200CH 100U V200CH 100U V200CH 100U V200CH 63U V200CH 50U V200CH 50U V200CH 50U V200CH 32U V200CH 32U V200CH 32U V200CH 32U V200CH 32U V200CH 220U V200CH 220U	V2005F 4M V2005F 3.55M V2005F 3.55M V2005F 3.15M V2005F 3.15M V2005F 2.36M V2005F 2.36M V2005F 2.36M V2005F 2.36M V2005F 1.5M V2005F 1.6M V2005F 1.6M V2005F 1.6M V2005F 1.6M V2005F 1.6M V2005F 1.6M V2005F 1.25M V2005F 1.25M V2005F 1.25M V2005F 1.25M V2005F 1.25M V2005F 1.12M V2005F 1.12M V2005F 1.12M V2005F 60U V2005F 60U V2005F 60U V2005F 60U V2005F 60U V2005F 60U V2005F 60U V2005F 60U V2005F 40U V2005F 40U V2005F 40U V2005F 25U V2005F 16U V2005F 100U V2005F 100U V2005F 100U V2005F 100U V2005F 100U V2005F 50U V2005F 50U V2005F 50U V2005F 50U V2005F 50U V2005F 50U V2005F 50U V2005F 50U V2005F 32U V2005F 32U V2005F 32U V2005F 32U V2005F 22U	V2005H 4M V2005H 3.55M V2005H 3.35M V2005H 3.35M V2005H 2.5M V2005H 2.5M V2005H 2.5M V2005H 2.5M V2005H 2.5M V2005H 2.5M V2005H 2.24M V2005H 1.7M V2005H 1.7M V2005H 1.7M V2005H 1.7M V2005H 1.7M V2005H 1.7M V2005H 1.7M V2005H 1.7M V2005H 1.25M V2005H 1.25M V2005H 1.25M V2005H 1.25M V2005H 4.25M V2005H 450U V2005H 112U V2005H 125U V2005H 35U V2005H 50U V2005H 50U V2005H 50U V2005H 50U V2005H 32U V2005H 425U V2005H 425U V2005H 425U V2005H 425U V2005H 425U V2005H 425U V2005H 425U V2005H 425U V2005H 32U V2005H 32U V2005H 32U V2005H 22U V2005H 32U V2005H 22U	V300SF 4M V300SF 3.55M V300SF 3.35M V300SF 3.35M V300SF 3.35M V300SF 2.36M V300SF 2.5M V300SF 2.5M V300SF 2.5M V300SF 2.5M V300SF 2.5M V300SF 1.7M V300SF 1.7M V300SF 1.7M V300SF 1.7M V300SF 1.7M V300SF 1.7M V300SF 1.25M V300SF 1.25M V300SF 1.25M V300SF 4.25M V300SF 450U V300SF 630U V300SF 630U V300SF 630U V300SF 630U V300SF 630U V300SF 630U V300SF 425U V300SF 40U V300SF 100U V300SF 53U V300SF 53U V300SF 53U V300SF 52U V300SF 425U V300SF 420 V300SF 420 V300SF 420 V300SF 420 V300SF 420 V300SF 420 V300SF 420	V300SH 4M V300SH 3.55M V300SH 3.55M V300SH 3.35M V300SH 2.5M V300SH 2.5M V300SH 2.5M V300SH 2.5M V300SH 2.5M V300SH 2.5M V300SH 2.24M V300SH 1.7M V300SH 1.25M V300SH 1.25M V300SH 1.25M V300SH 450U V300SH 850U V300SH 425U V300SH 425U V300SH 425U V300SH 112U V300SH 22U V300SH 125U V300SH 86U V300SH 63U V300SH 63U V300SH 63U V300SH 63U V300SH 42U V300SH 42U



ISO Test Sieves

TECH NOTE!

- ISO Test Sieves are available with opening sizes up to 125mm (5in). Please inquire for openings larger than 63mm.
- ISO Test Sieves are fitted with black rubber O-Rings.
- Details for Sieve Verification Services can be found in a separate listing within this section.
- ISO Sieves with 200mm or 300mm frames do not stack with ASTM 8in (203mm) or 12in (305mm) sieves.
- ISO Sieve Cloth can be custom mounted in 8in (203mm) frames. These items are non-returnable when supplied as ordered.

ACCESSORIES	
escription	Model
Iean-N-Stor accessories are handy, time-saving devices for emptying, cleaning and weighing unctions associated with sieving operations. Inverting an 8in or 200mm sieve on the stainless teel funnel allows quick emptying and cleaning of contents into a receiving scoop or pan. A sieve tack can also be stored on top of the funnel. A scoop and soft-bristle cleaning brush are included ith all models. The SSA-801 attaches to the top of the SS-8R case. SSA-802 is a stand-alone nodel that can be positioned directly over an electronic balance, so sieve fractions can be weighed s the sieve is being cleaned. OBA-15R is an adjustable-height Clean-N-Stor version designed of it over taller balances.	
Clean-N-Stor Attachment for SS-8R Stand-Alone Clean-N-Stor Adjustable-Height Clean-N-Stor	SSA-801 SSA-802 OBA-15R
ieve Storage Racks he SSA-820 Wall-Mount Sieve Rack is designed for wall-mounted storage of 8in (203mm) diameter ieves. Sieves are held on edge in eleven individual 3in (76mm) wide compartments, each holding ne full-height or two half-height sieves. Compartment bottoms are neoprene lined and inclined to beep sieves in place. Construction is all stainless steel. Holes are provided for mounting on 16in 06mm) centers and for bolting racks together vertically and/or horizontally. Rack construction all stainless steel with rubber feet for optional desk or counter top use. The bottom front flange as a 1-1/4in (32mm) high area to label slots for sieve sizes. Overall Assembled Dimensions: 4-1/4x9x11in (870x229x279mm), WxDxH. Est. Ship Wt.: 26lb (12kg). The SSA-822 Adjustable /all-Mount Sieve Rack for 12in (305mm) diameter sieves is similar in design to SSA-820, but as slots every 1/2in (13mm) for variable placement of the eight supplied dividers. Capacity is ight full-height or fourteen half-height sieves. Additional dividers are available in sets of five as SA-823. Overall Assembled Dimensions: 36-1/4x13x15-3/4in (921x330x400mm), WxDxH. Sieve ack Units are shipped with instructions for simple user assembly. Est. Ship Wt.: 40lb (18kg). The SA-803 Adjustable Bench Sieve Rack holds all diameters of sieves up to 12in (305mm). This rack liminates clutter and inconvenience of nested storage and facilitates easy retrieval of sieves for peed and efficiency in the lab. Stainless steel rack has non-skid rubber feet, and is supplied with vo permanent and two adjustable rubber-coated sieve support rods. Unit accommodates twenty ull-height forty half-height) 8in sieves, twelve full-height (twenty four half-height) 12in sieves, or orty full-height 3in sieves. Sizes may also be mixed, and be as small as 3in diameter. Optional SA-804 Support Rod Set contains two rubber-covered rods, and may be used to increase the apacity for 3in full-height sieves to eighty. Dimensions: 26x13x13in (660x330x330x30mm), WxDxH. st. Ship Wt.: 8lb (4kg).	SSA-820 SSA-822 SSA-803
mall Fine Sieve Cleaning Brush has soft, 100% China bristles in round 3/4in (19mm) ferrule nat are tapered for use with fine mesh sieves. Especially handy for 3in diameter or Precision lectroformed sieves and others of small diameter. Overall length is 5in (127mm) with wood handle.	TSA-168
ine Sieve Cleaning Brush is ideal for cleaning No.16 and finer sieves. Soft bristle, nickeled steel rrrule, lacquered wood handle, 1-1/4in diameter and 5-3/4in long.	TSA-170
oarse Sieve Cleaning Brush has an 8-1/2in curved plastic handle with 1-1/2in x 1-3/4in of slanted rass wire bristles—perfect for No.30 and coarser wire cloth in round sieves.	TSA-172



SSA-820 shown with Sieves

SSA-803 shown with 8in full-height Sieves

4